USA Ground Operations CIL Sheet DEC 1 5 1999

Critical Item: Bottom Final Limit Switch Criticality Category: 1S

NASA Part No: None Total Quantity: 4

Mfg/Part No: OMRON / D4B-3113N

System: FSS Electrical Passenger Elevators

Find No.	Qty	Area	PMN	Baseline	Drawing / Sheet
None	1	Pad-A	K60-0597-01	420.00	80K58931 / All
None	1	Pad-A	K60-0597-02	420.00	80K58931 / All
None	1	Pad-B	K60-0597-06	420.00	80K58931 / All
None	1	Pad-B	K60-0597-07	420.00	80K58931 / All

Function:

Trips when car travels more than 6 inches past the bottom floor level.

Failure Mode No. Failure Mode	Failure Cause Failure Effect	Detection Method Time to Effect	Crit Cat
09FY018-001.213	Internal piece part failure	Loss of car mobility	1S
Fail open	Possible loss of car mobility and/or failure of door operation. Loss of elevator function would prevent / delay ingress of rescue personnel during Flight Crew /Red Crew/Close-Out Crew rescue operations. Possible entrapment of personnel during hazardous fuel spill or fire. Could result in loss of life during a hazardous condition.	Immediate	

ACCEPTANCE RATIONALE

Design:

- This switch is typical equipment used in industry for the intended application.
- The design of the FSS elevator systems are consistent with ASME A17.1 (1994) Safety Code For Elevators And Escalators.

Test:

- The State of Florida requires bi-annual elevator inspection and certification.
- Annual testing and certification of elevators is performed per ANSI/ASME A17.1.
- OMRSD File VI requires that the FSS elevators are functionally tested (Ref. OMI S0007VL2) at T-8 hours.
- The Pad Close-out Crew performs additional functional check-out at T-25 Minutes.

Inspection:

- OMI Q3018 requires inspection and functional test after each launch.
- OMI Q6009 requires monthly inspection of Pad Electrical Passenger Elevators.

Failure History:

- Failures have been experienced with the elevator systems, however they have been attributed to burn-in type causes which do not represent current elevator operation. Critical failure modes identified are not represented in the burn-in type failures experienced.
- Current data on test failures, unexplained anomalies, and other failures experienced during ground
 processing activities can be found in the PRACA database. The PRACA database was researched and no
 data was found on this component in the critical failure mode.

Operational Use:

SAA09FY018-001

Rev. B

USA Ground Operations CIL Sheet DEC 1 5 1999				
Correcting Action	Timeframe			
There is no action which can be taken to mitigate the failure effect.	Since no correcting action is available,			
	timeframe does not apply.			